

TRAKKER® Antares™ 248X Badge Scanner Instruction Sheet

The badge scanner on your TRAKKER® Antares™ 2480, 2481, 2485, or 2486 terminal allows you to easily scan bar codes from badges or other cards. This instruction sheet explains how to install the badge scanner.



Caution


Integrated circuits on printed circuit boards (PCB) in this equipment are sensitive to damage by electrostatic discharge (ESD). Prevent ESD by always wearing skin contact ground straps firmly attached to the equipment metal base assembly when working inside of the equipment housing. Failure to comply may result in damage to PCB components.

Conseil


Les circuits intégrés des cartes de circuit imprimé (PCB) de cet équipement sont sensibles à l'endommagement dû à la décharge électrostatique (ESD). Évitez la décharge électrostatique en mettant toujours contre la peau des courroies neutralisantes attachées fermement à l'assemblage de la base en métal de l'équipement lorsque vous travaillez à l'intérieur du boîtier de l'équipement, faute de quoi vous risquez d'endommager les pièces des PCB.

To install the badge scanner

1. Turn off your terminal and unplug the power supply.
2. If you have a wall- or desk-mounted terminal, remove the mounting bracket from the terminal. For help, see the instruction sheet that came with the bracket.
3. Using a Phillips screwdriver, take out the two mounting screws and the badge scanner placeholder. Save and reuse the mounting screws to attach the badge scanner.
4. Insert the badge scanner into the badge scanner well.

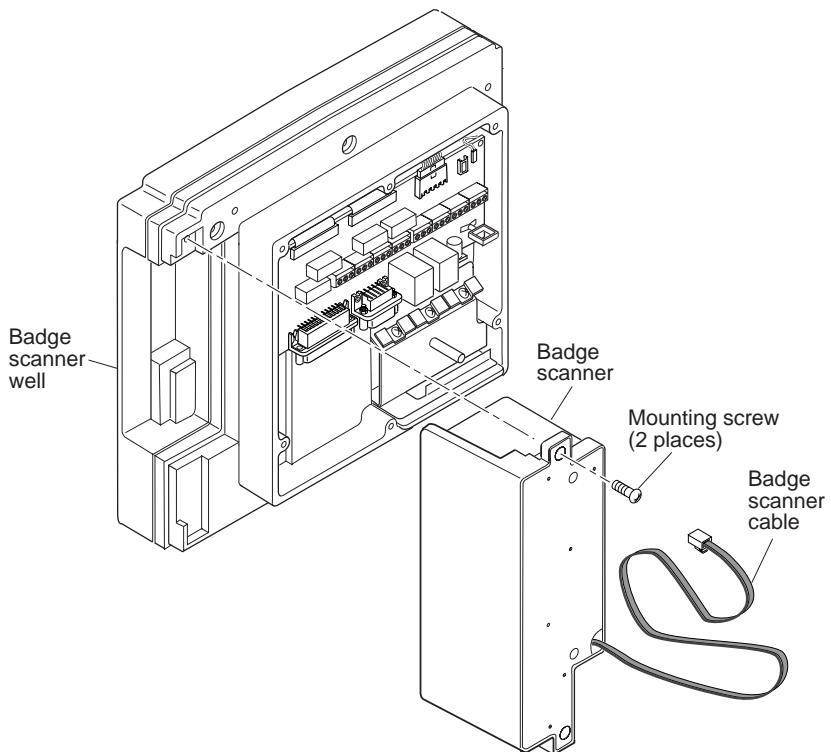

5. Insert and tighten the two mounting screws to secure the badge scanner to the terminal.
6. Take out the six screws and remove the terminal's back panel. Save and reuse the screws to replace the back panel.

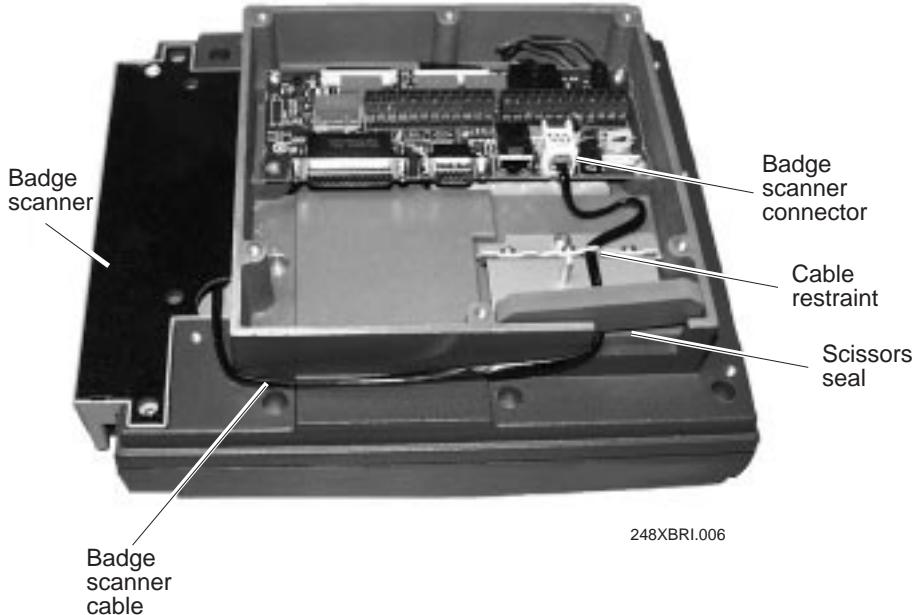

7. Keeping the scanner cable snug against the bottom edge of the rear enclosure, gently pull up on the scissors seal, pass the cable through the seal and under the cable restraint bar, and close the seal.
8. Loosen the screw on the cable restraint and pass the scanner cable under the cable restraint. Tighten the screw to secure the cable.
9. Plug the badge scanner cable into the badge scanner connector.
10. Replace the terminal's back panel and remount the terminal on the desk or wall.
11. Plug in the power supply and turn on the terminal.

Intermec
Technologies Corporation

6001 36th Avenue West
P.O. Box 4280
Everett, WA 98203-9280

© 1998 Intermec Corporation
All Rights Reserved
P/N 066993-001